

22 July 1966

SECRET

SUBJECT

Monthly UR Reports - June 1966

ACTION REQUIRED - REFERENCES

Project Hq Directive 45-9

- 6-1. 47532-3, MAG AMP., Serial Nbr. 75-C, Flight Time Unknown. Aircraft 385. Auto-pilot Fluctuates. Replaced with serviceable part, Serial Nbr. 56-158. NEGATIVE
- 6-2. SP95-31237, BRAKE ASSY MLG, Serial Nbr. 256-1015, Flight Time Unknown. Aircraft 383. Worn. Replaced with serviceable part, Serial Nbr. 125-E 1156. NEGATIVE
- 6-3. SP95-31237, BRAKE ASSY MLG, Serial Nbr. 1156-1212, Flight Time Unknown. Aircraft 385. Leaking Puck. Replaced with serviceable part, Serial Nbr. 1255-E 1156. NEGATIVE
- 6-4. Q468-1, ATTITUDE BYRO, Serial Nbr. AF57-7851P, Flight Time Unknown, Aircraft 384. Preset 10 degrees for 180 degrees turn. Replaced with serviceable part, Serial Nbr. AF52-22888. NEGATIVE
- 6-5. HR69178A, TACHOMETER SENSOR, Serial Nbr. SN-5, Flight Time Unknown, Aircraft 383. Erratic Signal. Replaced with serviceable part, Serial Nbr. SN-14 NEGATIVE
- 6-6. 47532-3, MAG AMP., Serial Nbr. 56-158, Flight Time Unknown. Aircraft 385. Fluctuates. Replaced with serviceable part, Serial Nbr. 96-209. NEGATIVE
- 6-7. RADIO, UHF TRANSCEIVER, ARC-34, Serial Nbr. UNK-2, Removed from 384, Transmitter and receiver went out, Replaced w/Serial Nbr G11645, Replaced AM-868, MO was off freq. Restored to Service. (OO Hours on UNK-2)
- 6-8. RADIO, UHF TRANSCEIVER, ARC-34, Serial Nbr. E-8265, OO Hours, Removed from Command Post, Cycled, V505 replaced, Restored to Service.
- 6-9. RADIO, UHF TRANSCEIVER, ARC-34, Serial Nbr. H13152, Command Post, Cycles erratically, AM-868 MO failed, Replaced AM-868, Restored to Service.
- 6-10. ARC-34, UHF TRANSCEIVER, Serial Nbr. G11645, Removed from 384, OO hours, Failed at launch, very noisy, no noise on bench check but cycled, replaced Control Select MX-1489, Restored to Service. 25X1
- 6-11. POWER SUPPLY, INFO AMP, Serial Nbr. 1004, Removed from 384, Unk hours, Fuse blew in flight, intermittent short due to oversize washers used to mount the filter capacitors, Removed washers, Restored to Service.
- 6-12. POWER SUPPLY, INFO AMP, Serial Nbr. 1006, Removed from 384, Unknown hours, Transformer T-1 shorted to chassis, Replaced transformer, Restored to service.

6-13.

- 6-14. RADIO, UHF TRANSCEIVER, ARC-34, Serial Nbr. G-12039, Removed from 383, Replacement G-12039 with E8296. Off Frequency. Mo in AM 868 bad. Replaced Am 868. 6 1/4 hours. G-12039 restored to service. 25X1

- 6-15. RADIO, UHF TRANSCEIVER, ARC-34, UNK-1, Removed from 383, Replacement G-12039, Cutting in and out and channalizing, Checked OK on Bench Check, Replaced tubes V601, 602, 603 and 604 in AM-868 and realigned. Restored to service.

6-16.

6-17.

6-18.

SECRET